


Sectors of Angle Rings

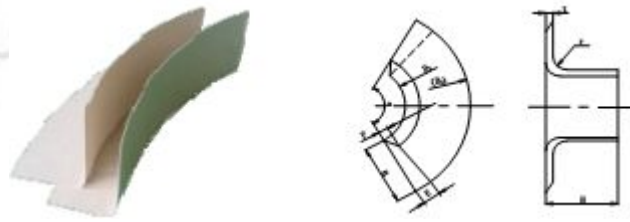

Suitable for insulating top and bottom coils. If it is placed in parallel with the electrical field line, it can enlarge the creepage distance and strengthen insulation property on machine direction of coils.

Dimensions and Tolerance(UNIT: mm)

W	H	r		t			
<200	<200	≤40	>40	1.0	1.5	2.0	3.0
±2	±2	±3	±5	0 +0.2	0 +0.4	0 +0.4	0 +0.6

Dimensions of molds:

模具中心直径	使用直径范围(常规)	使用直径范围(特殊)	分瓣数	H	W	T	R
400		375-425	4	≤200	≧200	1.0 1.5 2.0 3.0	20
450	401-500	425-475	5				10, 20
500		475-525	6				20
550	501-600	525-575	6				10, 20
600		575-625	7				20
700		675-725	7				10, 20
750	701-800	725-775	7				10, 15, 20, 50
800		775-825	7				10
850	801-900	825-875	8				10, 15, 20, 30, 40
900		875-925	8				5, 10, 20
950	901-1000	925-975	8				10, 15, 20, 30, 50
1000		975-1025	8				10
1050	1001-1100	1025-1075	9				10, 15, 20, 30, 40, 50
1150	1101-1200	1125-1175	9				10, 15, 20, 25, 30, 40, 50
1200		1175-1225	9				10, 15
1300	1201-1400	1250-1350	10				10, 15, 20, 30, 40, 50
1400		1350-1450	10				5, 10
1500	1401-1600	1450-1550	11				10, 15, 20, 30, 40, 50
1600		1550-1650	12				15, 20
1700	1601-1800	1650-1750	12				10, 20, 30, 40
1800		1750-1850	13				5
1900	1801-2000	1850-1950	13				10, 20, 30
2000		1950-2050	14				25
2100	2001-2200	2050-2150	14				10, 20, 30
2200		2150-2250	14	10, 20			
2300	2201-2400	2250-2350	15	20, 30, 40			
2400		2350-2450	16	5, 10			