


Sectors of Angle Caps

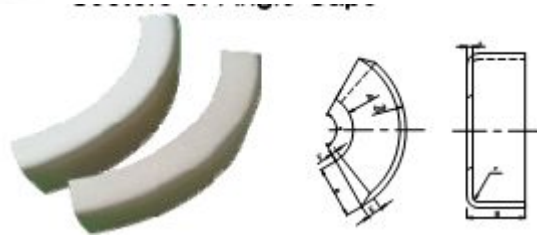

Suitable for insulating top and bottom coils. If it is placed in parallel with the electrical field line, it can enlarge the creepage distance and strengthen insulation property on machine direction of coils.

Dimensions and Tolerance(Unit: mm)

W	H	r		t			
<200	<200	≤40	>40	1.0	1.5	2.0	3.0
±2	±2	±3	±5	0 +0.2	0 +0.4	0 +0.4	0 +0.6

Dimension of molds:

模具中心直径	使用直径范围 (常规)	使用直径范围 (特殊)	分瓣数	H	W	t	r
550	501-600	525-575	6	≤200	≤200	1.0 1.5 2.0 3.0	10
650	601-700	625-675	6				15
750	701-800	725-775	6				10
800		775-825	6				20
850	801-900	825-875	6				10, 15, 20
950	901-1000	925-975	6				10, 20, 30
1050	1001-1100	1025-1075	6				10, 20, 40
1100		1075-1125	7				30, 40
1150	1101-1200	1125-1175	7				10, 20, 30
1300	1201-1400	1250-1350	8				10, 20, 30, 40
1350		1300-1400	8				20, 30
1400		1350-1450	9				30
1500	1401-1600	1450-1550	10				10, 20, 40
1600		1550-1650	11				5, 20
1700	1601-1800	1650-1750	11				15, 20
1750		1700-1800	12				5
1900	1801-2000	1850-1950	12				10, 50
2000		1950-2050	13				20, 50
2100	2001-2200	2050-2150	13				10, 30
2150		2100-2200	13				10, 20
2200		2150-2250	13				10
2250		2200-2300	14				15
2300	2201-2400	2250-2350	14				20
2500	2401-2600	2450-2550	15				10
2700	2601-2800	2650-2750	16				10, 20
2800		2750-2850	18				15
2900	2801-3000	2850-2950	19				